

SERVICE



LETTER

Service Letter No. 481

September 15, 1966

SUBJECT: Muffler and Tailpipe Support

MODELS AFFECTED: PA-24 "250" Comanches only, Serial Nos. 24-103 to 24-2174 incl.


This Service Letter is to advise that a muffler support bracket and a bracket to support the tailpipe are available for installation on the subject aircraft.

These supports are applicable to the PA-24 "250" Comanches only, within the serial numbers listed above and it is recommended that they be installed on these aircraft as the additional support will be instrumental in extending the service life of the exhaust system. See sketch on the reverse side of this letter.

Kit 757 058 contains the necessary material to accomplish this modification and is available through your Piper distributor at a suggested retail price of \$23.92.

(over)

PIPER AIRCRAFT CORPORATION, LOCK HAVEN, PA., U. S. A.

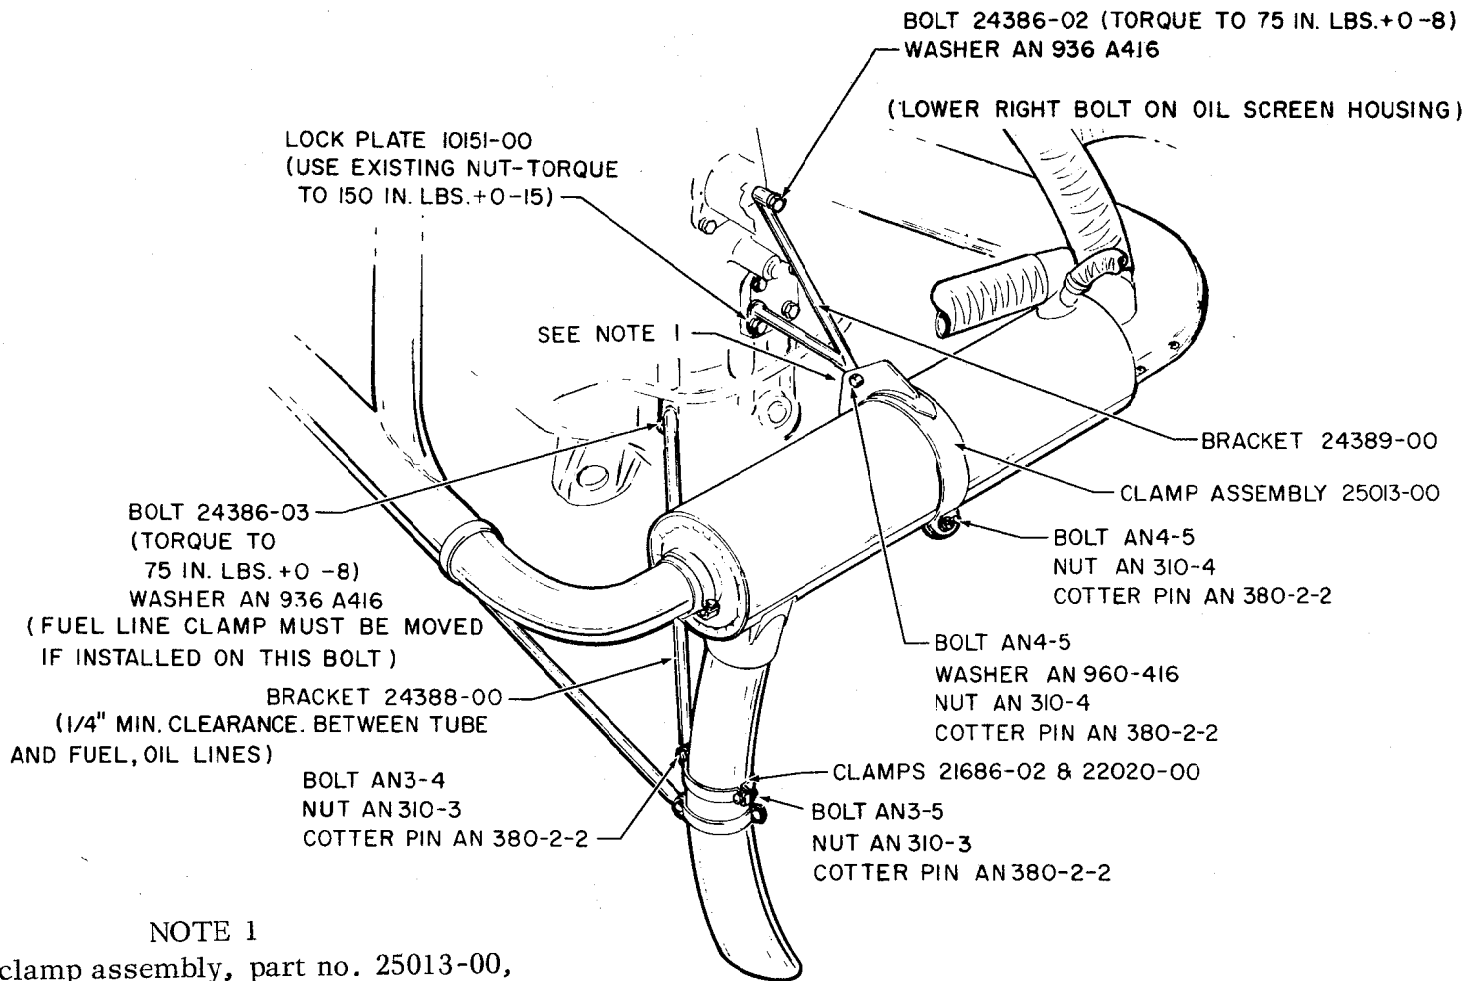

NOTE 1

Drill clamp assembly, part no. 25013-00, as necessary to align with support bracket, part no. 24309-00. (Drill $.250 \pm .003$ Hole)

Service Letter 481